

Six Degrees of Freedom Sensor

ADIS16364 Silicon Anomaly

ADIS16364 ANOMALIES

This anomaly list describes the known bugs, anomalies, and workarounds for the ADIS16364.

Analog Devices, Inc., is committed, through future silicon revisions, to continuously improve silicon functionality. Analog Devices tries to ensure that these future silicon revisions remain compatible with your present software/systems by implementing the recommended workarounds outlined here.

ANOMALY STATUS

Reference Number	Description	Status
er001	MSC_CTRL register programmed with incorrect default value	Fixed

MSC_CTRL DEFAULT VALUE INCORRECT [er001]	
Background	The ADIS16365 offers a data ready option with either DIO1 or DIO2, depending on the setting in MSC_CTRL Bits[2:0].
Issue	The factory default setting for MSC_CTRL is 0x0006, which sets DIO1 as a positive pulse, data ready signal. For some parts with a date code earlier than 0918, the factory default value was 0x0000, which disables the data ready function on DIO1. This has been resolved, and all new parts have a factory default setting of 0x0006 for MSC_CTRL. In addition, after this error was discovered, all existing inventory was corrected.
Workaround	When the power supply reaches 4.75 V, wait 500 ms to ensure that the part has started up, and then set MSC_CTRL Bits[7:0] = 0x06 by writing DIN = 0xB406. Next, execute a manual flash update by writing DIN = 0xBE08 (GLOB_CMD Bit3 = 1). Wait 100 ms, and then the device will operate with DIO1 as a positive pulse, data ready signal, and the setting will be nonvolatile.
Related Issues	None.

ADIS16364 Silicon Anomaly

NOTES

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Analog Devices Inc.:

ADIS16364BMLZ