
For board-to-FPC

#### Narrow pitch connectors (0.4mm pitch)

## A4S Series






**RoHS** compliant

#### **FEATURES**


#### 1. 2.5 mm wide slim two-piece type connector

Compact and slim structure contributes overall miniaturization of product design.

- <Compared to F4S series (40 pin contacts, when mated)>
- Width: 30% down
- Footprint: 30% down



2. "TOUGH CONTRET" ensures high resistance to various environments in lieu of slim and low profile body



Ni barrier construction Bellows contact construction (Against solder rise!) (Against dropping!) Porosity treatment (Against corrosive gases!)

V notch and Double contact constructions

(Against foreign particles and flux!)

- 3. Mated heights of 0.8 and 1.0 mm are available for the same foot pattern.
- 4. Connectors for inspection available

#### **APPLICATIONS**

Recommended for board-to-FPC connections of mobile equipment, such as cellular phones, smart phones, laptops, and portable music

#### ORDERING INFORMATION

**AXE** 2 5: Narrow Pitch Connector A4S (0.4 mm pitch) Socket 6: Narrow Pitch Connector A4S (0.4 mm pitch) Header Number of pins (2 digits) Mated height <Socket> 1: For mated height 0.8/1.0 mm <Header> 1: For mated height 0.8 mm 2: For mated height 1.0 mm **Functions** 2: Without positioning bosses Surface treatment (Contact portion / Terminal portion) <Socket> 4: Ni plating on base, Au plating on surface (for Ni barrier available) <Header> 4: Ni plating on base, Au plating on surface

## AXE5, 6

### **PRODUCT TYPES**

Motodlesisk	Number	Part n	umber	Packing			
Mated height	Number of pins	Socket	Header	Inner carton (1-reel)	Outer carton		
	10	AXE510124	AXE610124				
	12	AXE512124	AXE612124				
	14	AXE514124	AXE614124				
	16	AXE516124	AXE616124				
	18	AXE518124	AXE618124				
	20	AXE520124	AXE620124				
	22	AXE522124	AXE622124				
	24	AXE524124	AXE624124				
	26	AXE526124	AXE626124				
	28	AXE528124	AXE628124				
0.0	30	AXE530124	AXE630124				
0.8mm	32	AXE532124	AXE632124				
	34	AXE534124	AXE634124				
	36	AXE536124	AXE636124				
	40	AXE540124	AXE640124				
	44	AXE544124	AXE644124				
	50	AXE550124	AXE650124				
	54	AXE554124	AXE654124	5,000 pieces			
	60	AXE560124	AXE660124		10,000 pieces		
	64	AXE564124	AXE664124				
	70	AXE570124	AXE670124	]			
	80	AXE580124	AXE680124				
	10	AXE510124	AXE610224	]			
	12	AXE512124	AXE612224				
	14	AXE514124	AXE614224	]			
	20	AXE520124	AXE620224				
	24	AXE524124	AXE624224	]			
	26	AXE526124	AXE626224				
	30	AXE530124	AXE630224	]			
1.0mm	32	AXE532124	AXE632224				
	40	AXE540124	AXE640224				
	44	AXE544124	AXE644224				
	50	AXE550124	AXE650224				
	54	AXE554124	AXE654224				
	60	AXE560124	AXE660224				
	70	AXE570124	AXE670224				
	80	AXE580124	AXE680224				

Notes: 1. Order unit:
For volume production: 1-inner carton (1-reel) units
Samples for mounting check: 50-connector units. Please contact our sales office.
Samples: Small lot orders are possible. Please contact our sales office.
2. Please contact us for connectors having a number of pins other than those listed above.

#### **SPECIFICATIONS**

#### ■ Characteristics

Item		Specifications		Conditions				
	Rated current	0.3A/pin contact (Max. 5 A at total pin contacts)						
	Rated voltage	60V AC/DC						
Electrical characteristics	Breakdown voltage	150V AC for 1 min.			ge at a detection current of 1 mA s applied for one minute.			
ondraotonotioo	Insulation resistance	Min. 1,000M $\Omega$ (initial)	Using 2	50V DC megger (ap	plied for 1 min.)			
	Contact resistance	Max. 90mΩ		Based on the contact resistance measurement meth specified by JIS C 5402.				
	Composite insertion force	Max. 1.200N/pin contacts × pin contacts (initial)						
Mechanical	Composite removal force	Min. 0.165N/pin contacts × pin contacts						
characteristics	Contact holding force (Socket contact)	Min. 0.20N/pin contacts		ing the maximum for contact is axially pull				
	Ambient temperature	−55°C to +85°C	No free:	zing at low temperat	ures. No dew condensation.			
	Soldering heat resistance	Peak temperature: 260°C or less (on the surface of the PC board around the connector terminals)	Infrared	Infrared reflow soldering				
	_	300°C within 5 sec. 350°C within 3 sec.	Soldering iron					
Storage temperature		-55°C to +85°C (product only) -40°C to +50°C (emboss packing)	No freezing at low temperatures. No dew condensation					
			Conformed to MIL-STD-202F, method 107G					
			Order	Temperature (°C)	Time (minutes)			
		5 cycles,	1	<b>-</b> 55_3	30			
Environmental	Thermal shock resistance (header and socket mated)	insulation resistance min. 100M $\Omega$ ,	2	S	Max. 5			
characteristics	(fleader and socket mateu)	contact resistance max. $90m\Omega$	3	85+3	30			
			4	∫ -55 <sub>-3</sub> °	Max. 5			
Humidity resistance (header and socket mated)  Saltwater spray resistance (header and socket mated)		120 hours, insulation resistance min. $100M\Omega$ , contact resistance max. $90m\Omega$		Bath temperature 40±2°C, humidity 90 to 95% R.H.				
		24 hours, insulation resistance min. 100M $\Omega$ , contact resistance max. 90m $\Omega$		Bath temperature 35±2°C, saltwater concentration 5±1%				
	H <sub>2</sub> S resistance (header and socket mated)	48 hours, contact resistance max. 90mΩ	Bath temperature 40±2°C, gas concentration 3±1 ppm, humidity 75 to 80% R.H.					
Lifetime characteristics	Insertion and removal life	30 times	Repeate	Repeated insertion and removal speed of max. 200 time				
Unit weight		20 pin contact type: Socket: 0.02 g Header: 0.01 g						

#### ■ Material and surface treatment

Part name	Material	Surface treatment						
Molded portion	LCP resin (UL94V-0)							
Contact and Post	Copper alloy	Contact portion: Base: Ni plating Surface: Au plating Terminal portion: Base: Ni plating Surface: Au plating (except the terminal tips) The socket terminals close to the portion to be soldered have nickel barriers (exposed nickel portions). Soldering terminals: Sockets: Base: Ni plating Surface: Pd+Au flash plating (except the terminal tips) Headers: Base: Ni plating Surface: Au plating (except the terminal tips)						


#### **DIMENSIONS** (Unit: mm)


The CAD data of the products with a CAD Data mark can be downloaded from: http://industrial.panasonic.com/ac/e/


#### ■ Socket (Mated height: 0.8 mm/1.0 mm)

#### CAD Data



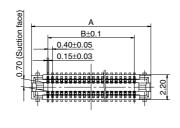

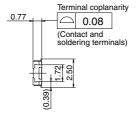



General tolerance: ±0.2

Note: Since the soldering terminals has a single-piece construction, sections Y and Z are electrically connected.


#### Dimension table (mm)


oldasi riolollolli	,		
Number of pins/ dimension	А	В	С
10	4.50	1.60	3.40
12	4.90	2.00	3.80
14	5.30	2.40	4.20
16	5.70	2.80	4.60
18	6.10	3.20	5.00
20	6.50	3.60	5.40
22	6.90	4.00	5.80
24	7.30	4.40	6.20
26	7.70	4.80	6.60
28	8.10	5.20	7.00
30	8.50	5.60	7.40
32	8.90	6.00	7.80
34	9.30	6.40	8.20
36	9.70	6.80	8.60
40	10.50	7.60	9.40
44	11.30	8.40	10.20
50	12.50	9.60	11.40
54	13.30	10.40	12.20
60	14.50	11.60	13.40
64	15.30	12.40	14.20
70	16.50	13.60	15.40
80	18.50	15.60	17.40


#### ■ Header (Mated height: 0.8 mm)

#### CAD Data





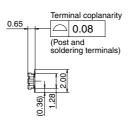




General tolerance: ±0.2

#### Dimension table (mm)

(	,		
Number of pins/ dimension	А		С
10	3.80	1.60	3.20
12	4.20	2.00	3.60
14	4.60	2.40	4.00
16	5.00	2.80	4.40
18	5.40	3.20	4.80
20	5.80	3.60	5.20
22	6.20	4.00	5.60
24	6.60	4.40	6.00
26	7.00	4.80	6.40
28	7.40	5.20	6.80
30	7.80	5.60	7.20
32	8.20	6.00	7.60
34	8.60	6.40	8.00
36	9.00	6.80	8.40
40	9.80	7.60	9.20
44	10.60	8.40	10.00
50	11.80	9.60	11.20
54	12.60	10.40	12.00
60	13.80	11.60	13.20
64	14.60	12.40	14.00
70	15.80	13.60	15.20
80	17.80	15.60	17.20


#### ■ Header (Mated height: 1.0 mm)

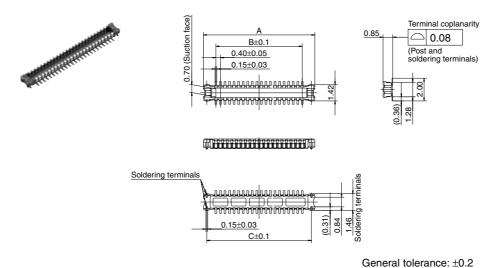

#### Dimension table (mm)

,	,		
Number of pins/ dimension	А	В	С
10	3.80	1.60	3.20
12	4.20	2.00	3.60
14	4.60	2.40	4.00
20	5.80	3.60	5.20
24	6.60	4.40	6.00
26	7.00	4.80	6.40
30	7.80	5.60	7.20
32	8.20	6.00	7.60
40	9.80	7.60	9.20
44	10.60	8.40	10.00
50	11.80	9.60	11.20
54	12.60	10.40	12.00
60	13.80	11.60	13.20
70	15.80	13.60	15.20
80	17.80	15.60	17.20

#### ■ Socket and Header are mated






#### EMBOSSED TAPE DIMENSIONS (Unit: mm) (Common for respective contact types, sockets and headers)


#### ■ Specifications for taping

(In accordance with JIS C 0806-3:1999. However, not applied to the mounting-hole pitch of some connectors.)

#### ■ Specifications for the plastic reel

(In accordance with EIAJ ET-7200B.)

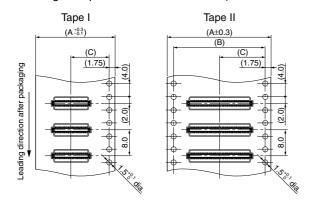


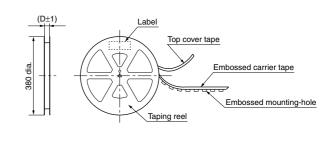

#### ■ Dimension table (Unit: mm)

	,						
Type/Mated height	Number of pins	Type of taping	А	В	С	D	Quantity per reel
Common for sockets	Max. 24	Tape I	16.00	_	7.50	17.40	5,000
and headers	26 to 70	Tape I	24.00	_	11.50	25.40	5,000
0.8 mm/1.0 mm	80	Tape II	32.00	28.40	14.20	33.40	5,000


#### ■ Connector orientation with respect to embossed tape feeding direction

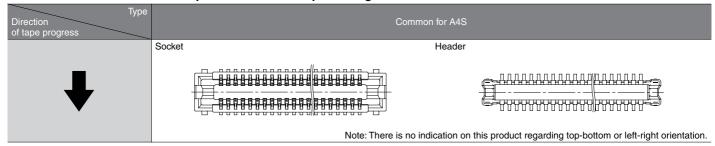

For board-to-FPC

# Connectors for inspection usage (0.4mm pitch)

## $\mathsf{A4S}$ Series



**RoHS** compliant

#### **FEATURES**

- 1. 3,000 mating and unmating cycles
- 2. Same external dimensions and foot pattern as standard type.
- 3. Improved mating

Insertion and removal easy due to a reduction in mating retention force. This is made possible by a simple locking structure design.

Note: Mating retention force cannot be warranted.

#### **APPLICATIONS**

Ideal for module unit inspection and equipment assembly inspection

#### **TABLE OF PRODUCT TYPES**

☆: Available for sale

Product name										1	Numbe	of pin										
A4S	10	12	14	16	18	20	22	24	26	28	30	32	34	36	40	44	50	54	60	64	70	80
for inspection	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆	☆

Notes: 1. Please inquire about number of pins other than those shown above.

- 2. Please inquire with us regarding availability.
- 3. Please keep the minimum order quantities no less than 50 pieces per lot.
- 4. Please inquire if further information is needed.

#### **PRODUCT TYPES**

Specifications		Part No.		Part No.	
Socket	Without positioning bosses	AXE5E**26	Header	Without positioning bosses	AXE6E**26

Note: When placing an order, substitute the "\*" (asterisk) in the above part number with the number of pins for the specific connector.


#### NOTES

## ■ Recommended PC board and metal mask patterns


Connectors are mounted with high pitch density, intervals of 0.35 mm, 0.4 mm or 0.5 mm.

In order to reduce solder and flux rise, solder bridges and other issues make sure the proper levels of solder is used. The figures to the right are recommended metal mask patterns. Please use them as a reference.


## Socket (Mated height: 0.8mm/1.0mm) Recommended PC board pattern (TOP VIEW)




Recommended metal mask pattern
Metal mask thickness: When 120µm
(Terminal opening ratio: 70%)
(Metal-part opening ratio: 100%)



## Header (Mated height: 0.8mm/1.0mm) Recommended PC board pattern (TOP VIEW)



#### Recommended metal mask pattern Metal mask thickness: When 120µm (Terminal opening ratio: 70%) (Metal-part opening ratio: 100%)

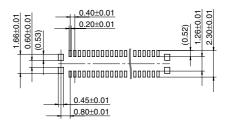


Please refer to the latest product specifications when designing your product.

#### Regarding the design of devices and PC board patterns

- 1) When connecting several connectors together by stacking, make sure to maintain proper accuracy in the design of structure and mounting equipment so that the connectors are not subjected to twisting and torsional forces.
- 2) With mounting equipment, there may be up to a  $\pm 0.2$  to 0.3-mm error in positioning. Be sure to design PC boards and patterns while taking into consideration the performance and abilities of the required equipment.
- 3) Some connectors have tabs embossed on the body to aid in positioning. When using these connectors, make sure that the PC board is designed with positioning holes to match these tabs.
- 4) To ensure the required mechanical strength when soldering the connector terminals, make sure the PC board meets recommended PC board pattern design dimensions given.

5) For all connectors of the narrow pitch series, to prevent the PC board from coming off during vibrations or impacts, and to prevent loads from falling directly on the soldered portions, be sure to design some means to fix the PC board in place.

#### Example) Secure in place with screws



When connecting PC boards, take appropriate measures to prevent the connector from coming off.

- 6) Notes when using a FPC.
- (1) When the connector is soldered to an FPC board, during its insertion and removal procedures, forces may be applied to the terminals and cause the soldering to come off. It is recommended to use a reinforcement board on the

backside of the FPC board to which the connector is being connected. Please make the reinforcement board dimensions bigger than the outer limits of the recommended PC board pattern (should be approximately 1 mm greater than the outer limit).

Material should be glass epoxy or polyimide, and the thickness should be between 0.2 and 0.3 mm.

- (2) Collisions, impacts, or turning of FPC boards, may apply forces on the connector and cause it to come loose. Therefore, make to design retaining plates or screws that will fix the connector in place.
- 7) The narrow pitch connector series is designed to be compact and thin. Although ease of handling has been taken into account, take care when mating the connectors, as displacement or angled mating could damage or deform the connector.


## Regarding the selection of the connector placement machine and the mounting procedures

- 1) Select the placement machine taking into consideration the connector height, required positioning accuracy, and packaging conditions.
- 2) Be aware that if the catching force of the placement machine is too great, it may deform the shape of the connector body or connector terminals.
- 3) Be aware that during mounting, external forces may be applied to the connector contact surfaces and terminals and cause deformations.
- 4) Depending on the size of the connector being used, self alignment may not be possible. In such cases, be sure to carefully position the terminal with the PC board pattern.
- 5) The positioning bosses give an approximate alignment for positioning on the PC board. For accurate positioning of the connector when mounting it to the PC board, we recommend using an automatic positioning machine.
- 6) Excessive mounter chucking force may deform the molded or metal part of the connector. Consult us in advance if chucking is to be applied.

#### Regarding soldering

#### 1. Reflow soldering

- 1) Measure the recommended profile temperature for reflow soldering by placing a sensor on the PC board near the connector surface or terminals. (The setting for the sensor will differ depending on the sensor used, so be sure to carefully read the instructions that comes with it.)
- 2) As for cream solder printing, screen printing is recommended.
- 3) To determine the relationship between the screen opening area and the PC-board foot pattern area, refer to the diagrams in the recommended patterns for PC boards and metal masks. Make sure to use the terminal tip as a reference position when setting. Avoid an excessive amount of solder from being applied, otherwise, interference by the solder will cause an imperfect contact.




- 4) Consult us when using a screenprinting thickness other than that recommended.
- 5) When mounting on both sides of the PC board and the connector is mounting on the underside, use adhesives or other means to ensure the connector is properly fixed to the PC board. (Double reflow soldering on the same side is possible.)
- 6) N<sub>2</sub> reflow, conducting reflow soldering in a nitrogen atmosphere, increases the solder flow too greatly, enabling wicking to occur. Make sure that the solder feed rate and temperature profile are appropriate.


#### Soldering conditions

Please use the reflow temperature profile conditions recommended below for reflow soldering. Please contact us before using a temperature profile other than that described below (e.g. lead-free solder).

 Narrow pitch connectors (except P8 type)

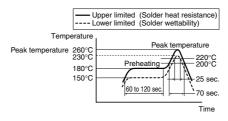

Narrow pitch connector (P8)



For products other than the ones above, please refer to the latest product specifications.

- 7) The temperatures are measured at the surface of the PC board near the connector terminals. (The setting for the sensor will differ depending on the sensor used, so be sure to carefully read the instructions that comes with it.)
- 8) The temperature profiles given in this catalog are values measured when using the connector on a resin-based PC board. When performed reflow soldering on a metal board (iron, aluminum, etc.) or a metal table to mount on a FPC, make sure there is no deformation or discoloration of the connector beforehand and then begin mounting.
- 9) Consult us when using a screenprinting thickness other than that recommended.
- 10) Some solder and flux types may cause serious solder or flux creeping. Solder and flux characteristics should be taken into consideration when setting the reflow soldering conditions.


#### 2. Hand soldering

1) Set the soldering iron so that the tip temperature is less than that given in the table below.

#### Table A

Product name	Soldering iron temperature
SMD type connectors	300°C within 5 sec. 350°C within 3 sec.

- 2) Do not allow flux to spread onto the connector leads or PC board. This may lead to flux rising up to the connector inside.
- 3) Touch the soldering iron to the foot pattern. After the foot pattern and connector terminal are heated, apply the solder wire so it melts at the end of the connector terminals.

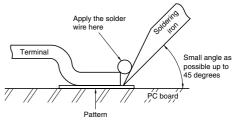

- 4) Be aware that soldering while applying a load on the connector terminals may cause improper operation of the connector.
- 5) Thoroughly clean the soldering iron.
  6) Flux from the solder wire may get on the contact surfaces during soldering operations. After soldering, carefully check the contact surfaces and clean off any solder before use.
- 7) For soldering of prototype devices during product development, you can perform soldering at the necessary locations by heating with a hot-air gun by applying cream solder to the foot pattern beforehand. However, at this time, make sure that the air pressure does not move connectors by carefully holding them down with tweezers or other similar tool. Also, be careful not to go too close to the connectors and melt any of the molded components.
- 8) If an excessive amount of solder is applied during manual soldering, the solder may creep up near the contact points, or solder interference may cause imperfect contact.

#### 3. Solder reworking


- 1) Finish reworking in one operation.
- 2) For reworking of the solder bridge, use a soldering iron with a flat tip. To prevent flux from climbing up to the contact surfaces, do not add more flux.
- 3) Keep the soldering iron tip temperature below the temperature given in Table A.

#### **Handling Single Components**

- 1) Make sure not to drop or allow parts to fall from work bench
- 2) Excessive force applied to the terminals could cause warping, come out, or weaken the adhesive strength of the solder. Handle with care.
- 3) Repeated bending of the terminals may cause terminals to break.
- 4) Do not insert or remove the connector when it is not soldered. Forcibly applied external pressure on the terminals can weaken the adherence of the terminals to the molded part or cause the terminals to lose their evenness.
- 5) Excessive prying-force applied to one end may cause product breakage and separation of the solder joints at the terminal.

Excessive force applied for insertion in a pivot action as shown may also cause product breakage.

Align the header and socket positions before connecting them.



#### Cleaning flux from PC board

- 1) To increase the cleanliness of the cleaning fluid and cleaning operations, prepare equipment for cleaning process beginning with boil cleaning, ultrasonic cleaning, and then vapor cleaning.
- 2) Carefully oversee the cleanliness of the cleaning fluids to make sure that the contact surfaces do not become dirty from the cleaning fluid itself.
- 3) Since some powerful cleaning solutions may dissolve molded components of the connector and wipe off or discolor printed letters, we recommend aqua pura electronic parts cleaners. Please consult us if you wish to use other types of cleaning fluids.
- 4) Please note that the surfaces of molded parts may whiten when cleaned with alcohol.

#### Handling the PC board

• Handling the PC board after mounting the connector

When cutting or bending the PC board after mounting the connector, be careful that the soldered sections are subjected to excessive force.



#### Storage of connectors

- 1) To prevent problems from voids or air pockets due to heat of reflow soldering, avoid storing the connectors in areas of high humidity. When storing the connectors for more than six months, be sure to consider storage area where the humidity is properly controlled.
- 2) Depending on the connector type, the color of the connector may vary from connector to connector depending on when it is produced.

Some connectors may change color slightly if subjected to ultraviolet rays during storage. This is normal and will not affect the operation of the connector.

3) When storing the connectors with the PC boards assembled and components alreeady set, be careful not to stack them up so the connectors are subjected to excessive forces.

4) Avoid storing the connectors in locations with excessive dust. The dust may accumulate and cause improper connections at the contact surfaces.


#### **Other Notes**


- 1) These products are made for the design of compact and lightweight devices and therefore the thickness of the molded components has been made very thin. Therefore, be careful during insertion and removal operations for excessive forces applied may damage the products.
- 2) Dropping of the products or rough mishandling may bend or damage the terminals and possibly hinder proper reflow soldering.
- 3) Before soldering, try not to insert or remove the connector more than absolutely necessary.
- 4) When coating the PC board after soldering the connector to prevent the deterioration of insulation, perform the coating in such a way so that the coating does not get on the connector.
- 5) There may be variations in the colors of products from different production lots. This is normal.
- 6) The connectors are not meant to be used for switching.
- 7) Be sure not to allow external pressure to act on connectors when assembling PCBs or moving in block assemblies.

#### Regarding sample orders to confirm proper mounting

When ordering samples to confirm proper mounting with the placement machine, connectors are delivered in 50-piece units in the condition given right. Consult a sale representative for ordering sample units.

Condition when delivered from manufacturing



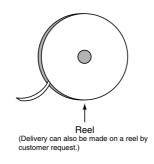

Please refer to the latest product specifications when designing your product.

## **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

#### Panasonic:

AXE510124 AXE512124 AXE514124 AXE516124 AXE518124 AXE520124 AXE522124 AXE524124

AXE526124 AXE530124 AXE532124 AXE534124 AXE536124 AXE536124 AXE540124 AXE550124 AXE560124 AXE564124

AXE570124 AXE580124 AXE610124 AXE612124 AXE618124 AXE620124 AXE622124 AXE624124

AXE626124 AXE628124 AXE632124 AXE636124 AXE664124 AXE670124 AXE680124 AXE528124 AXE544124

AXE554124 AXE644124 AXE644124 AXE630224 AXE680224 AXE620224 AXE670224 AXE624224

AXE650224 AXE614224