

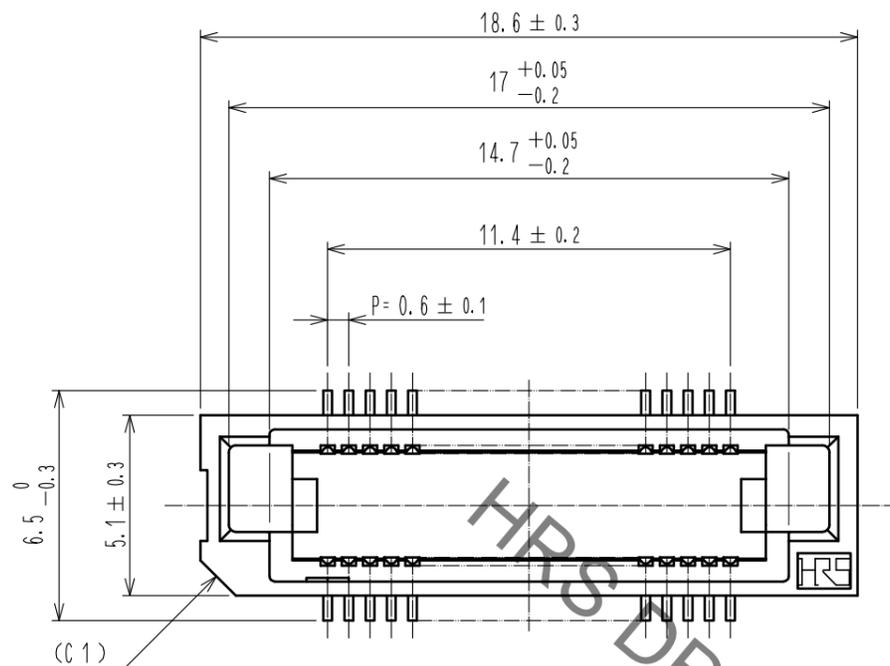
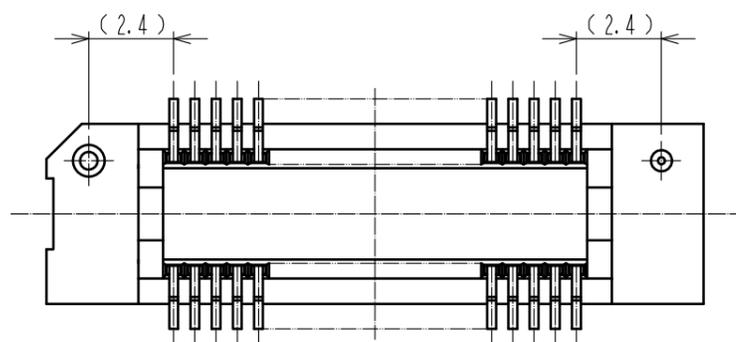
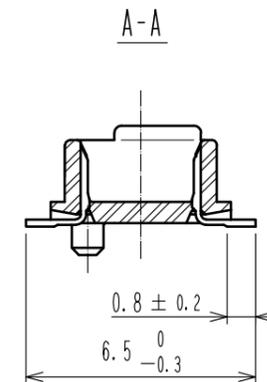
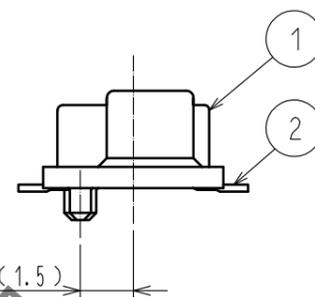


Dec.1.2020 Copyright 2020 HIROSE ELECTRIC CO., LTD. All Rights Reserved.  
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

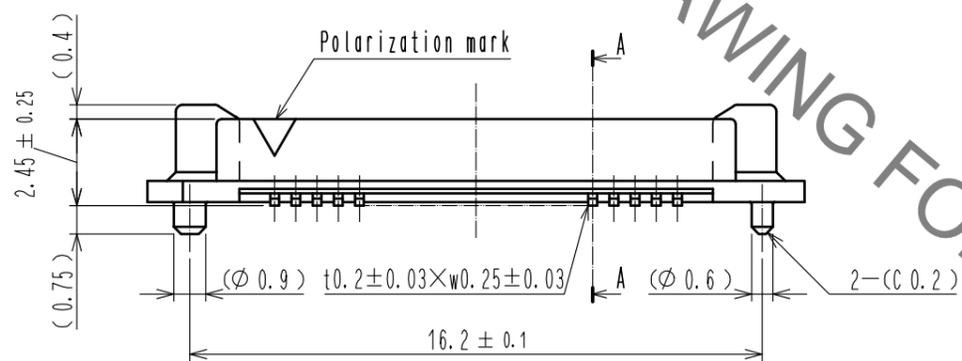

Recommended land pattern dimension of PCB (mounting side) (2:1)

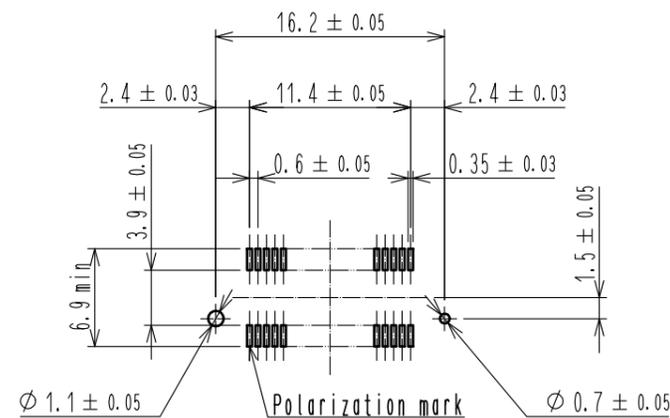

- Notes 1 Lead CO-PLANARITY shall be 0.1mm max.  
2 For modification, etc., preventive hole for sink mark may be added according to circumstances.  
3 The dimensions in parentheses are for reference.

1		PPS	Light brown (UL94V-0)	2		PHOSPHOR BRONZE	Contact area : Gold 0.1µm min. Lead area : Gold flash Under plating : Nickel 0.5µm min.		
NO.	MATERIAL	FINISH . REMARKS		NO.	MATERIAL	FINISH . REMARKS			
UNITS	mm	SCALE	5 : 1	COUNT	1	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
						DIS-F-00006410	KS. NAKAJIMA	HT. YAMAGUCHI	20200803
APPROVED : HS. OKAWA		20051109		DRAWING NO.		EDC-150989-71-25			
CHECKED : HS. OZAWA		20051109		PART NO.		FX8-40P-SV(71)			
DESIGNED : TK. YANAGISAWA		20051109		CODE NO.		CL578-0009-8-71			
DRAWN : TK. YANAGISAWA		20051109							

Added precaution



Dec.1.2020 Copyright 2020 HIROSE ELECTRIC CO., LTD. All Rights Reserved.  
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

【 Precaution 】

When a board with multiple connectors mounted is mated, the connector may be damaged or deformed.  
Please divide one side of the board so only one connector is mated per board.

OK

NG

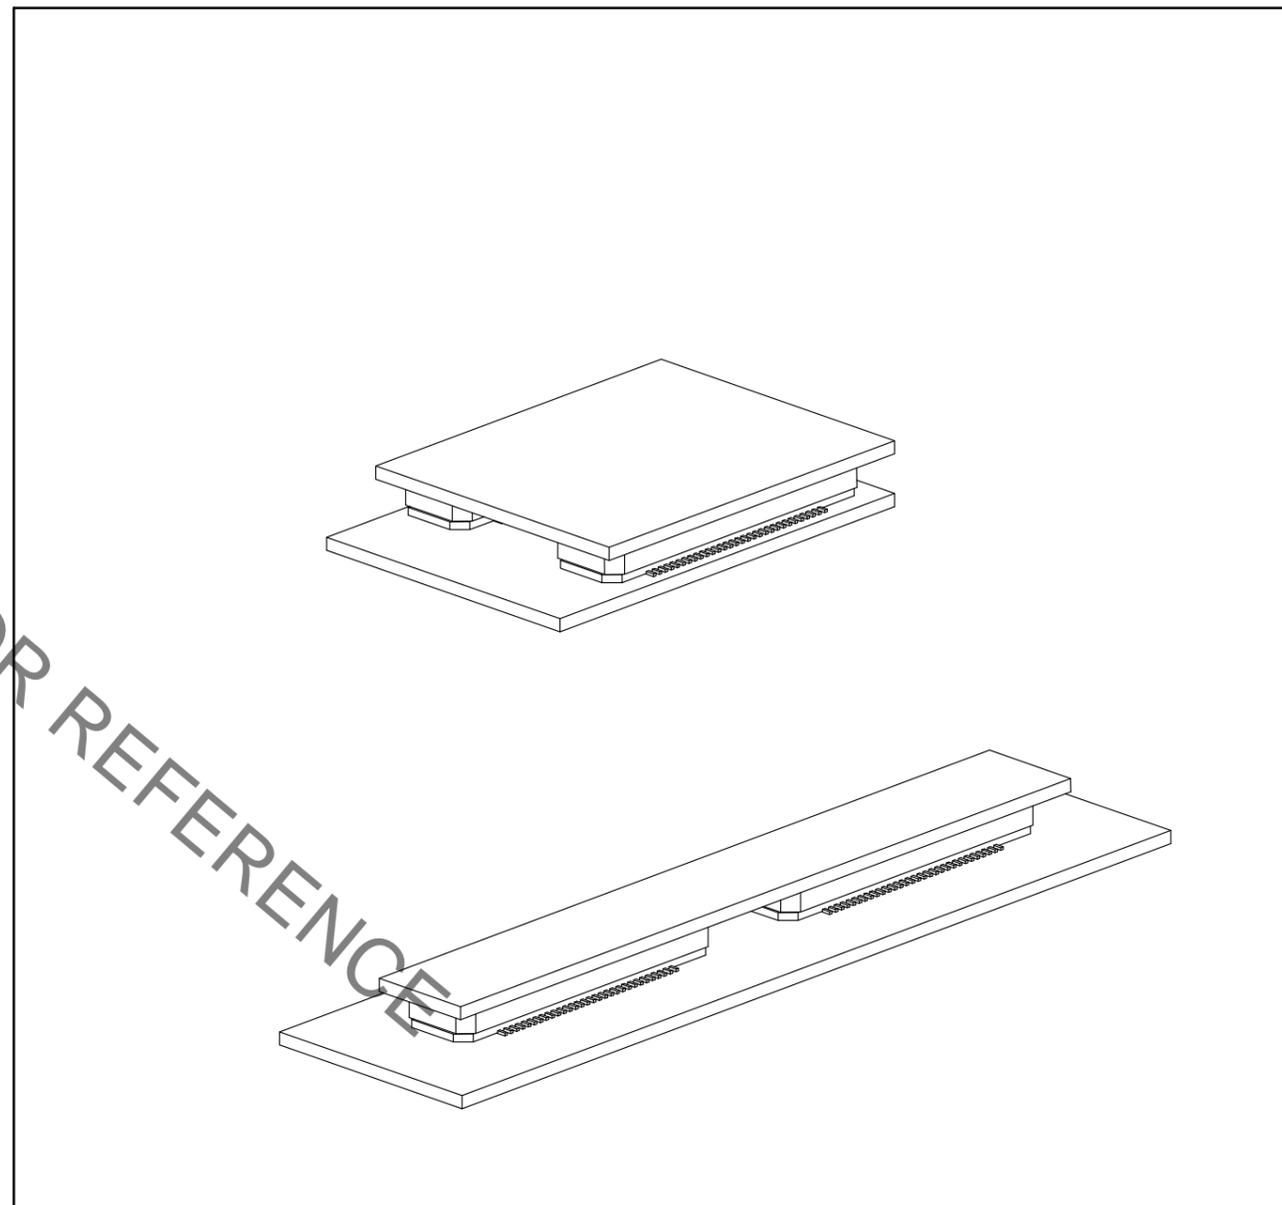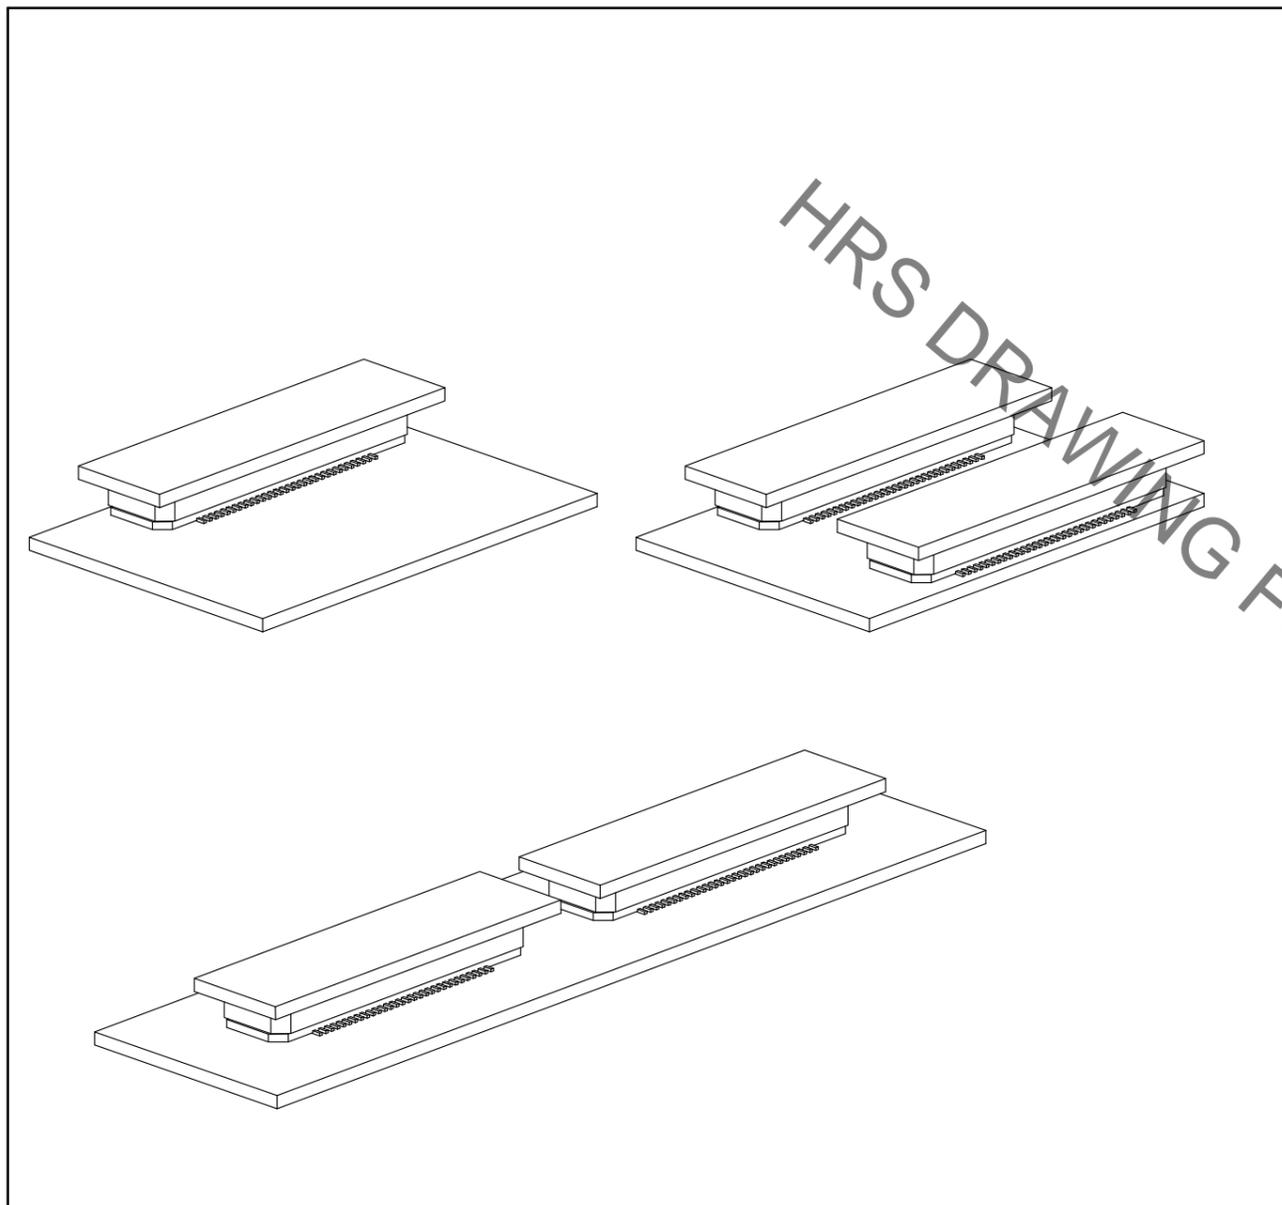

HRS DRAWING FOR REFERENCE

<b>HRS</b>	DRAWING NO.	EDC-150989-71-25
	PART NO.	FX8-40P-SV(71)
	CODE NO.	CL578-0009-8-71
		2/2