
STRAIGHT PLUG FULL CRIMP TYPE

CABLE 0.6/2.8 PACK.100

R142.077.702

Series : **BNC 75 HDTV**

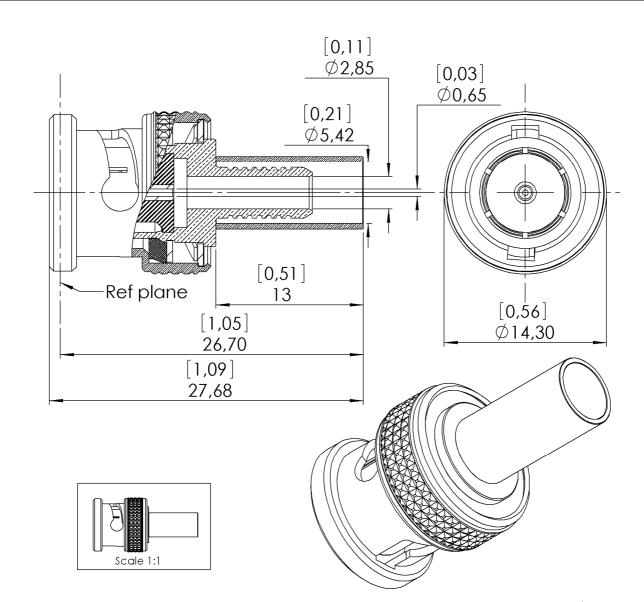

All dimensions are in mm.

COMPONENTS	MATERIALS	PLATING (µm)
BODY CENTER CONTACT OUTER CONTACT INSULATOR GASKET OTHERS PARTS	BRASS BRASS BRASS PTFE SILICONE RUBBER BRASS	NPGR NPGR NPGR
- -	-	-

Issue: 1001 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.



STRAIGHT PLUG FULL CRIMP TYPE

CABLE 0.6/2.8 PACK.100

R142.077.702

Series: BNC 75 HDTV

PACKAGING

Standard	Unit	Other
100	'W' option	Contact us

ELECTRICAL CHARACTERISTICS

Impedance 75 Ω Frequency DC-6 GHz

VSWR 1.05 + 0,0350 x F(GHz) Maxi Insertion loss 0.1 $\sqrt{F(GHz)}$ dB Maxi RF leakage - (AD - F(GHz)) dB Maxi

Voltage rating 500 Veff Maxi Dielectric withstanding voltage Insulation resistance 1500 Veff mini 5000 M Ω mini

MECHANICAL CHARACTERISTICS

Center contact retention

Axial force – Mating end
Axial force – Opposite end
Torque

10 N mini
NA N.cm mini

Recommended torque

Mating N.cm
Panel nut N.cm
Clamp nut N.cm
A/F clamp nut 0,0000 mm

Mating life 1000 Cycles mini

Weight **8,8150** g

ENVIRONMENTAL

Operating temperature -65/+165 ° C

Hermetic seal Atm.cm3/s

Panel leakage

SPECIFICATION

CABLE ASSEMBLY

Stripping	a	b	С	d	e	f
mm	3,50	10,8	18,0	0,00	0,00	0,00

Assembly instruction: Crimp 02

Recommended cable(s) DRAKA HDTV 0.6/2.8 CAE HDTV HD 0628

Characteristics indicated on this data sheet are those that can be achieved with the highest performance cable. Intrinsic limitations of the cable may diminish the performance of the assembly

Cable retention

- pull off- torqueN miniNA N.cm

TOOLING

Part Number	Description	Hexagon
		•
R282.235.011	CRIMPING DIES	5.41
	M22520/5-11	
R282.233.000	CRIMPING TOOL	5.41_
		square 1.1

OTHER CHARACTERISTICS

Issue: 1001 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.



STRAIGHT PLUG FULL CRIMP TYPE

CABLE 0.6/2.8 PACK.100


R142.077.702


Series : **BNC 75 HDTV**

COMPONENTS

Centre contact

STRIPPING DIMENSIONS

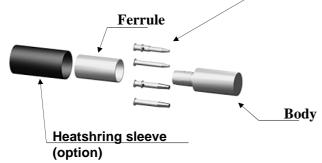

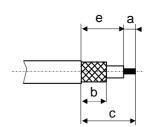

1

Slide the heatshrink sleeve onto the cable (Option). Slide the ferrule onto the cable. Strip the cable.



4

Slide the cable into the body until it bottoms against insulator.



2

Slide the centre contact on until it bottoms against the cable dielectric.


Crimp the centre contact with crimping tool (see connector TDS).



5


Slide the ferrule over the braid.

Crimp the ferrule with crimping tool (see connector

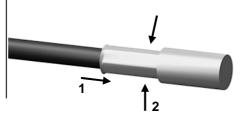

3

Fan the braid.

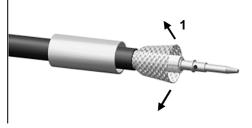

6

Cut the excess of braid if necessary. Slide the sleeve over the ferrule and heatshrink it in place (Option).



Issue: 1001 C

In the effort to improve our products, we reserve the right to make changes judged to be necessary.



Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Radiall:

R142077702