



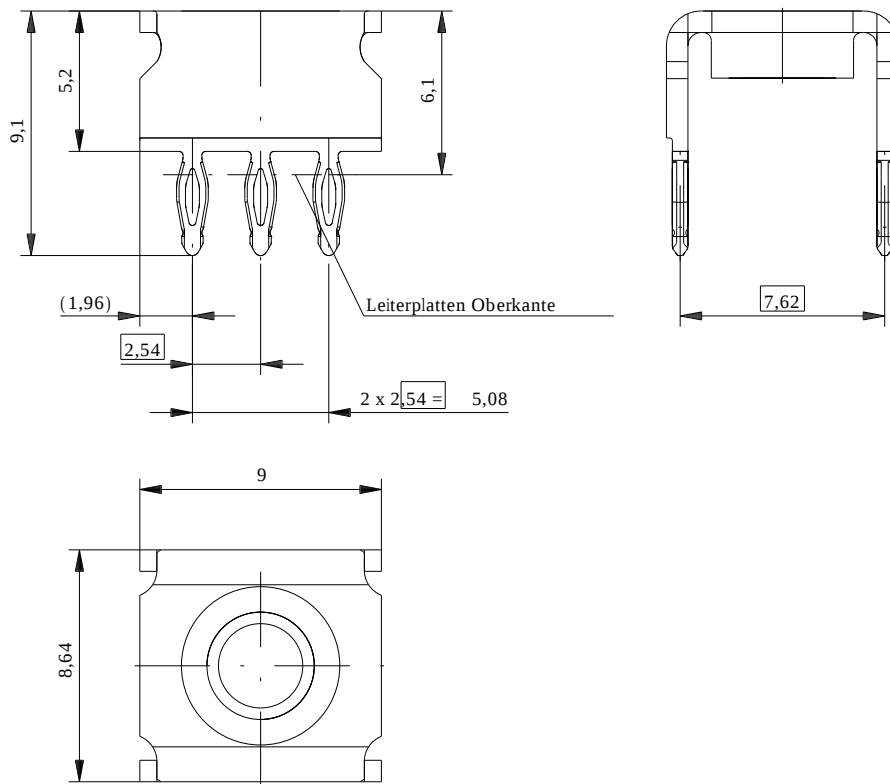

Leiterplattenbohrbild
PCB drillhole pattern

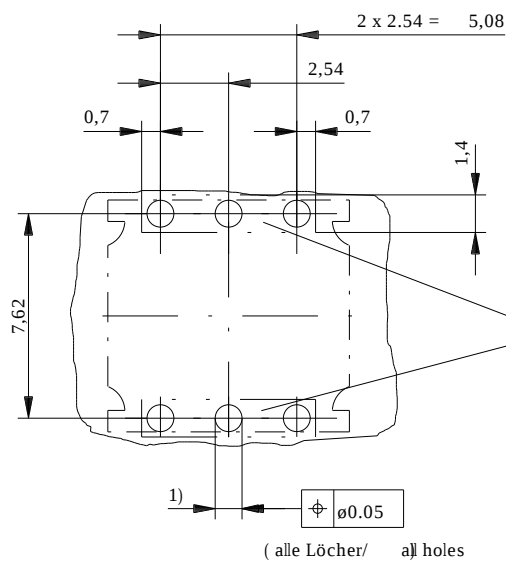

Schichtaufbau im metallisierten Loch siehe Zeichnung 114124

diameter of drilled hole see drawing 114124

- 1) $\varnothing 1,0^{+0,09}_{-0,06}$ Durchmesser des metallisierten Loches
 $\varnothing 1,0^{+0,09}_{-0,06}$ Diameter of finished plated-through hole
 $\varnothing 1,15 \pm 0,025$ Bohrungsdurchmesser des Loches
 $\varnothing 1,15 \pm 0,025$ Diameter of drilled hole

Dieser Bereich muß gleiches
Potential auf LP-Oberfläche
haben

This area must have same
electrical potential
on surface of PCB

214787	M4
214796	M3
214797	6-32UNC
214798	8-32UNC
Ident-Nr. Part No.	Gewinde thread

Information:		Tolerances		Scale	5:1
All rights reserved. Only for information. To insure that this is the latest version of this drawing, please contact one of the ERNI companies before using.		Subject to modification without prior notice. Drawing will not be updated.		Designation	
b		11.05.2006		SVA 6-polig EE Power Bug 6pin EE	
Index		Date		204820	
		C:00057489.SZA		EPSVA	

Consider protection memo from DIN 34

ERNI

www.ERNI.com

I

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[ERNI Electronics:](#)

[214787](#)